

IMPORTANT


NEW MODEL - 26ER8BA

The following updates are required for the user of this Manual to reflect changes in the RIDER MOWER on Models 26ER8BA.

1. The method of mounting the seat to the RIDER (Page 20, Figure 22) is changed to the following procedure.

IMPORTANT ASSEMBLY INSTRUCTIONS

SEAT MOUNTING: THE ER8-36 RIDER USES A SEAT SWITCH FOR OPERATOR SAFETY TO INSURE PROPER OPERATION OF THIS DEVICE ASSEMBLE SEAT AS SHOWN.

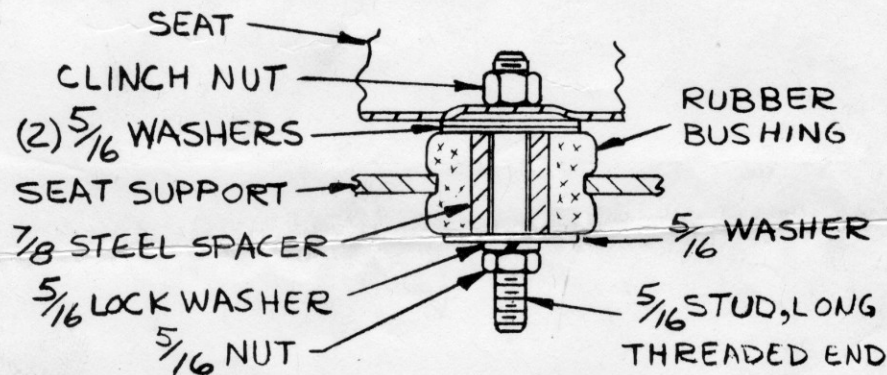

INSTALL STUDS (SHORT THREADED END) INTO SEAT. WRENCH ON NON THREADED PORTION OF STUD. BOTTOM THREAD AGAINST SEAT CLINCH NUT. TIGHTEN $\frac{5}{16}$ NUTS SUCH THAT THE RUBBER BUSHINGS ARE FULLY COMPRESSED AND THE FLAT WASHERS BOTTOM ON THE $\frac{7}{8}$ LONG STEEL SPACER.

191B4618 R-0

This decal will be found attached to the seat bottom.

2. Refer to Page 7, Figure 7, fuse panel. The center and bottom fuses labeled as MOWER, SLO-BLO 30 AMP have been changed to 40 AMP. This change reflects a change of mower motor protection by the use of internal circuit breakers.

